

Date: Thursday, 3/30/2006 8:33:13 AM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: MID TUBE ASSEMBLY
Job Number	: 26429		
Estimate Number	: 10469		
P.O. Number	: NIA	Part Number	: D3391023
This Issue	: 3/30/2006 S.O. No. : NIA	Drawing Number	: D3391 REV D
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: NIA Type : LANDING GEAR	Drawing Revision	: D
Previous Run	: 25516	Material	: NIA
Written By	: <u>SEE COMMENT BELOW</u>	Due Date	: 4/20/2006 Qty: 1 Um: Each
Checked & Approved By	: <u>06.03.30 W</u>		
Comment	: Est. A 05.10.20 New Issue KJ/EC Est. B 06.02.10 ECN773 dwg rev.D EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D25001100	Skidtube Extrusion
-----	-----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

SKIDTUBE EXTRUSION

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-100	Extrusion	BE 06-04-05 (1)

2.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Cut tube to finish length as per Dwg D3391 BE 06-04-05 (1)

2-Identify as D3391-023 BE 06-04-05 (1)

3-Drill pilot holes using DT8796 as per Dwg D3391 BE 06-04-05 (1)

4-Open float bag holes to Ø.250" as per Dwg D3391 using DT8796D visual aid Jig BE 06-04-05 (1)

5-C'sink float bag holes as per Dwg D3391 BE 06-04-05 (1)

6-Open remaining holes to Ø.375" BE 06-04-05 (1)

7-Remove .030" from Fwd indexing Ridge as per Dwg D3391 BE 06-04-05 (1)

8-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391 BE 06-04-05 (1)

9-Deburr BE 06-04-05 (1)

10-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø.208" holes with paint marker BE 06-04-05 (1)

11-Open wearplate holes of D3391-023 assembly detail section G-G to Ø.208" (14 holes) as per Dwg BE 06-04-05 (1)
D339112-Open wearplate holes of D3391-023 assembly detail section H-H to Ø.250" and c'sink (20 holes) BE 06-04-05 (1)
as per Dwg D3391

13-Open .375" holes to .438" BE 06-04-05 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/30/2006 8:33:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 26429

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

114-Deburr and blow out all chips from inside tube

BE 06-04-05 ①

3.0

QC5

INSPECT WORK TO CURRENT STEP



060405

Comment: INSPECT WORK TO CURRENT STEP

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

25 06-04-06 ①

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 06-4-06

6.0

D33891

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEB

Pick:

Qty

Part Number

Description

Batch

1

D3389-1

Web

526438

A/R

Sikaflex-241/-291

M 100480

Sikaflex expire date:

06-11-01

Start: 06-04-05 Time: 11:40

25 06-04-05

Finish: 06-04-06 Time: 11:40

25 06-04-05

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Bond web in place as per Dwg D3391 & QSI 015.

Adhere for 12 hours)

25 06 04 05

8.0

NAS1330C3KB116

Insert



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Insert

Pick:

Qty

Part Number

Description

Batch

20

NAS1330C3KB116

Insert

M19349

PL 06/05/25 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: 12 Date: 06/06/15
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/30/2006 8:33:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 26429

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

NAS1330C3KB166



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

RivnuT

Pick:

Qty Part Number

Description

Batch

10

NAS1330C3KB166

Insert

M100732

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Install inserts as per Dwg D3391

DL 06/05/25 (1)

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect each insert using DT8821

ML 06 05 26 (1)

12.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

Use paint screws to mask inserts.

DL 06/05/23

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 06 05 25 (1)

14.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: N/A

DL 06/05/30

15.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

DL 06/06/14 (1)

Job Completion



W 06.06.14


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

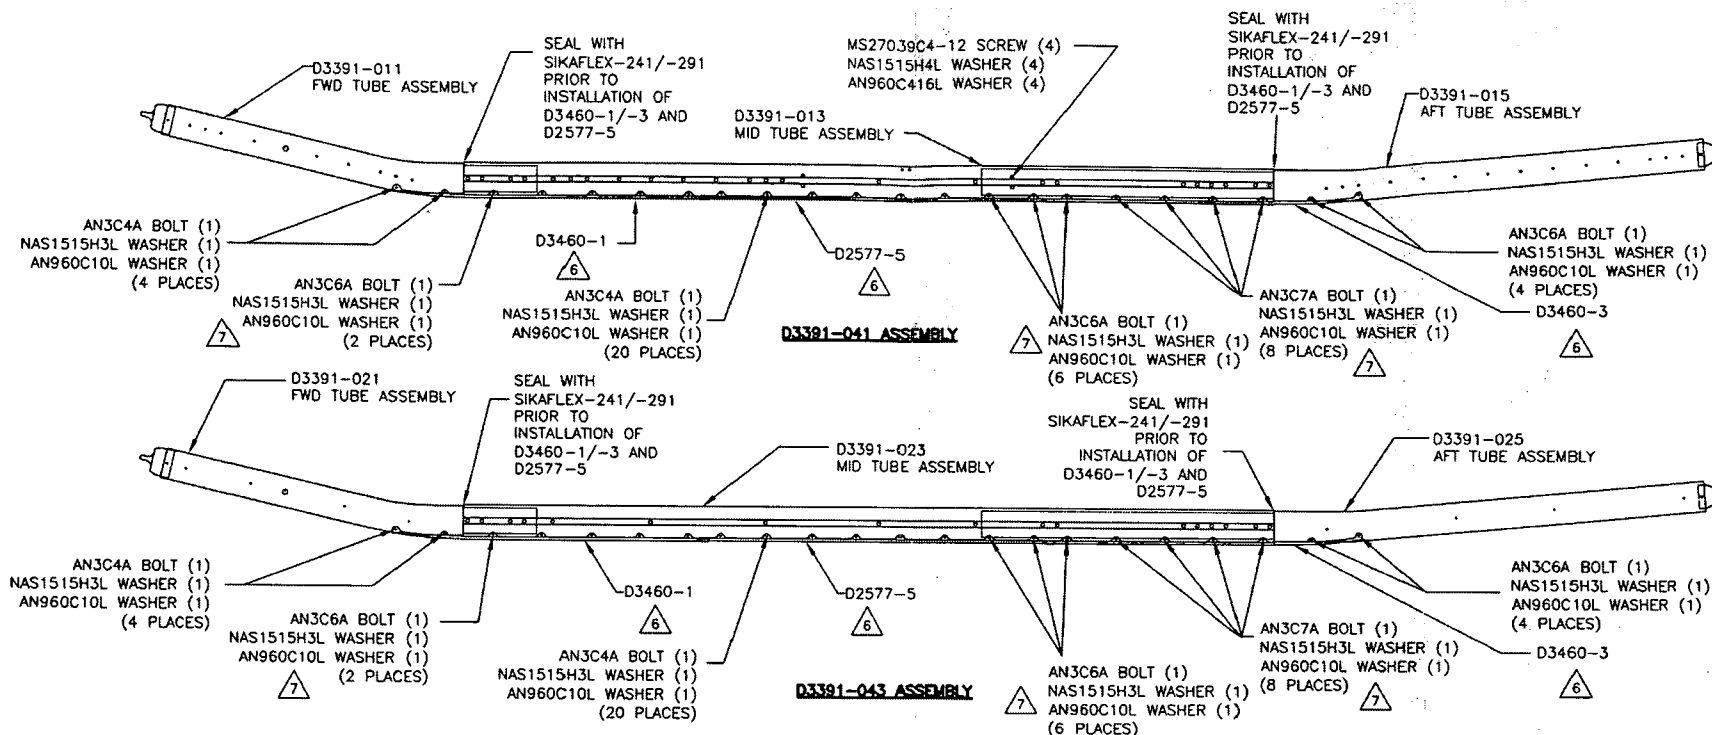

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY - 041	QTY - 043	PART NUMBER	DESCRIPTION
X		D3391-041	FLOAT SKIDTUBE ASSEMBLY
	X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
24	24	AN3C4A	BOLT
12	12	AN3C6A	BOLT
8	8	AN3C7A	BOLT
44	44	NAS1515H3L	WASHER
44	44	AN960C10L	WASHER
4		MS27039C4-12	SCREW
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
1	1	D2577-5	WEARSHOE
1	1	D3460-1	WEARSHOE
1	1	D3460-3	WEARSHOE

GENERAL NOTES

- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- FINISH: ACID ETCH AND ALODINE PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 'E' SIZE HOLES (Ø0.250-Ø0.257) FOR WEARSHOE INSERTS. C/SINK Ø0.391/Ø0.425 x 100" AS APPLICABLE AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES
- DO NOT TORQUE, HAND TIGHTEN ONLY

△

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 26429
WORK ORDER










RELEASED

06.01.27

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	D	06.01.23	UPDATE TOLERANCE, CHANGE HOLE SIZE
CHECKED	PH	05.09.27	LENGTHEN AFT EXTENSION
DATE	06.01.23	05.06.10	DRAWING UPDATES
	A	05.02.07	NEW ISSUE
DRAWN BY	PH		
APPROVED			
DRAWING NO.	D3391		
TITLE	412 FLOAT SKIDTUBE		
REV. D			
SHEET 1 OF 5			
SCALE			
NTS			

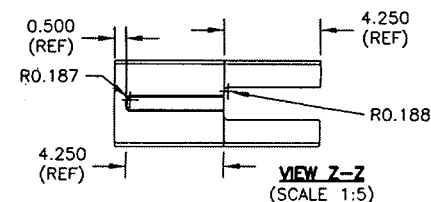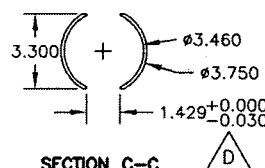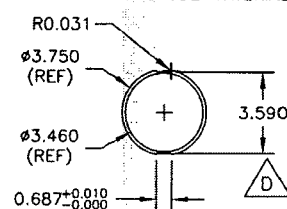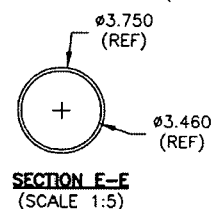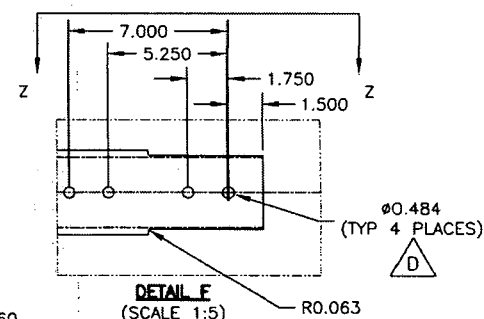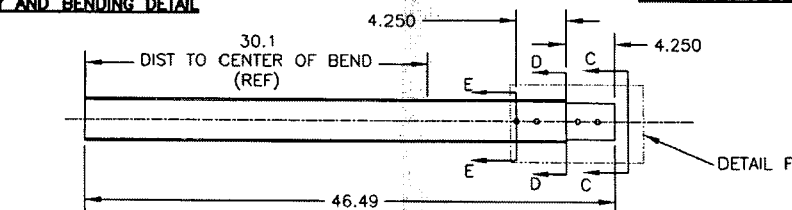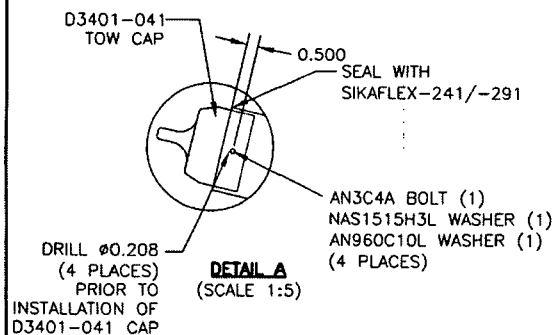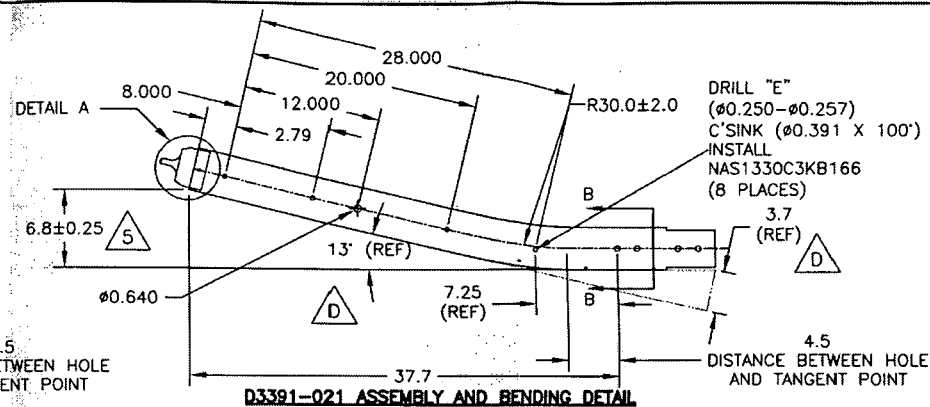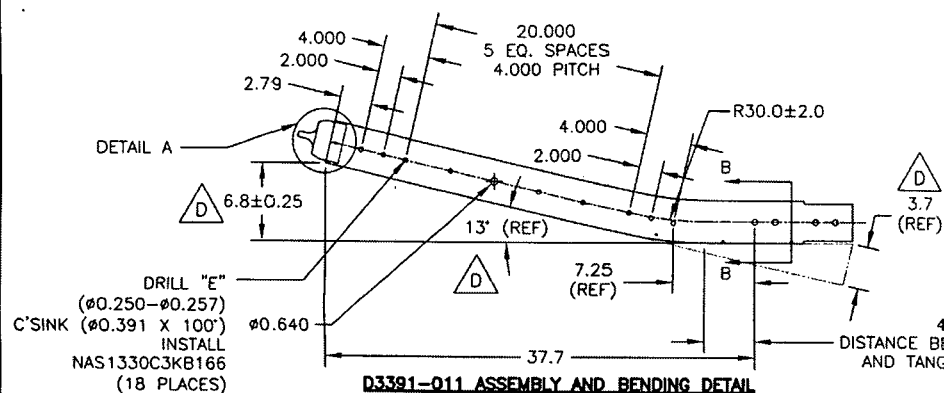


D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
4	4	AN3C4A	BOLT
4	4	NAS1515H3L	WASHER
4	4	AN960C10L	WASHER
24	14	NAS1330C3KB166	INSERT


WORK ORDER
06-01-27
SUBJECT TO AMENDMENT
WITHOUT NOTICE
RETURN TO
ENGINEERING
FOR COPY

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.
 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, OH
CHECKED #	APPROVED #	DRAWING NO. D3391
DATE 06.01.23	TITLE 412 FLOAT SKIDTUBE	REV. D SHEET 2 OF 5 SCALE 1:10

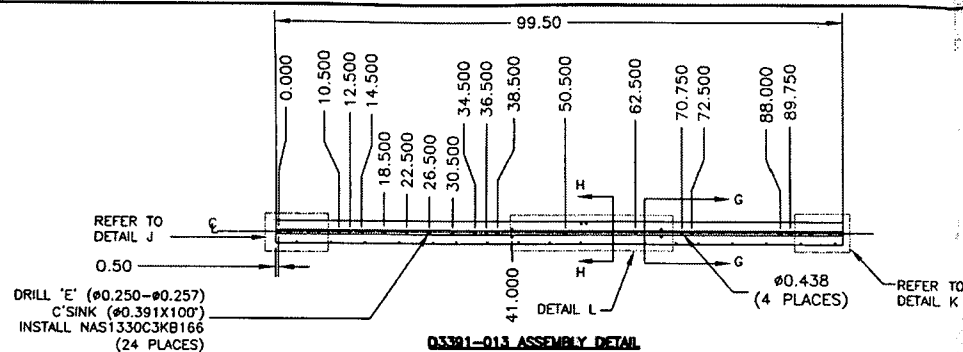


D3391-013 ASSEMBLY DETAIL

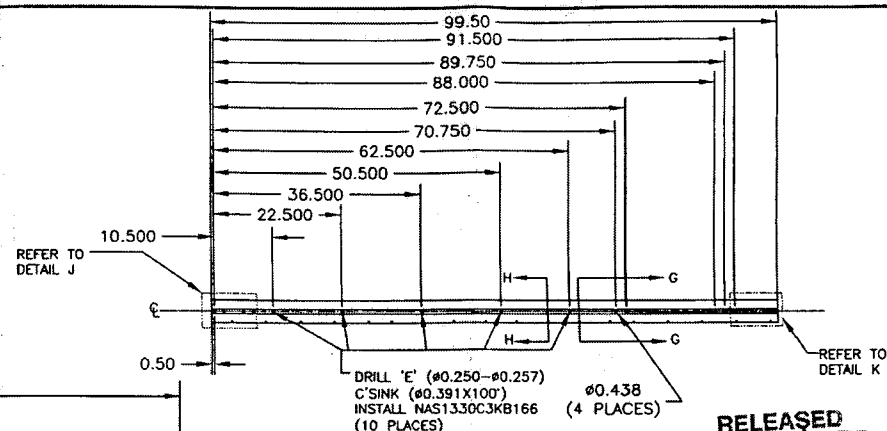


D3391-023 ASSEMBLY DETAIL

RELEASED
06.01.27

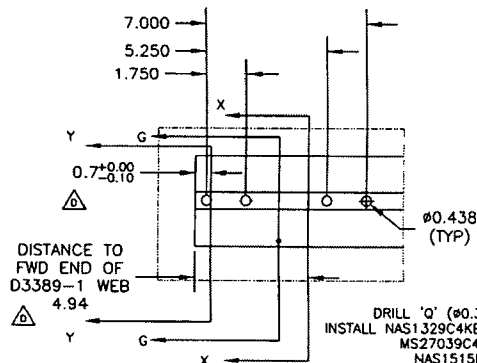


DETAIL J (SCALE 1:5)

DRILL 'O' (#0.332-#0.338)
INSTALL NAS1329C4KB140 INSERT
MS27039C4-08 SCREW
NAS1515H4L WASHER
AN960C416L WASHER
(TYP 4 PLACES)

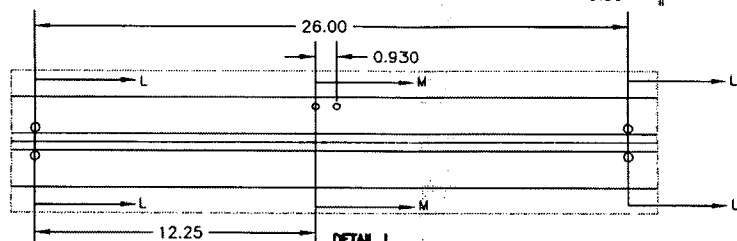

DETAIL L (SCALE 1:5)

DRILL 'E' (#0.250-#0.257)
C'SINK (#0.391X100)
INSTALL NAS1330C3KB116 INSERT
MS27039C1-09 SCREW
NAS1515H3L WASHER
AN960C10L WASHER
(TYP 4 PLACES)

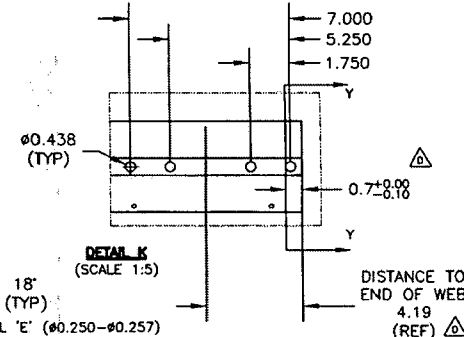

DETAIL K (SCALE 1:5)


D3391-013/-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 013	QTY - 023	PART NUMBER	DESCRIPTION
X	X	D3391-013	MID TUBE ASSEMBLY
		D3391-023	MID TUBE ASSEMBLY
1	1	D2500-1-100	EXTRUSION
1	1	D3389-1	WEB
24	20	NAS1330C3KB116	INSERT
24	10	NAS1330C3KB166	INSERT
4		NAS1329C4KB140	INSERT
4		NAS1515H3L	WASHER
4		AN960C10L	WASHER
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
4		MS27039C1-09	SCREW
4		MS27039C4-08	SCREW

SECTION L-L (SCALE 1:4)

SECTION M-M (SCALE 1:4)

SECTION LL-LL (SCALE 1:4)

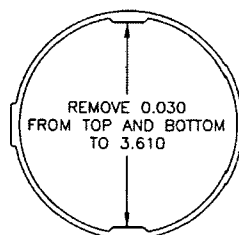

SECTION X-X (SCALE 1:2)

REMOVE 0.225 FROM TOP AND BOTTOM TO 3.800 (0.7 FROM BOTH ENDS)

SECTION Y-Y (SCALE 1:4)

SECTION G-G (SCALE 1:4)

SECTION H-H (SCALE 1:4)

COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.

DESIGN PH
CHECKED PH

DRAWN BY PH
APPROVED PH
DART DART AEROSPACE USA, INC.
PORT HADLOCK, OH

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DATE 06.01.23

DRAWING NO. D3391
TITLE 412 FLOAT SKIDTUBE
REV. D SHEET 3 OF 5
SCALE 1:20


D3391-013/-023 MID TUBE ASSEMBLY

- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSE015


WORK ORDER
26424
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING

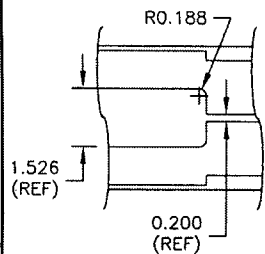

VIEW BB-BB
(SCALE 1:3)

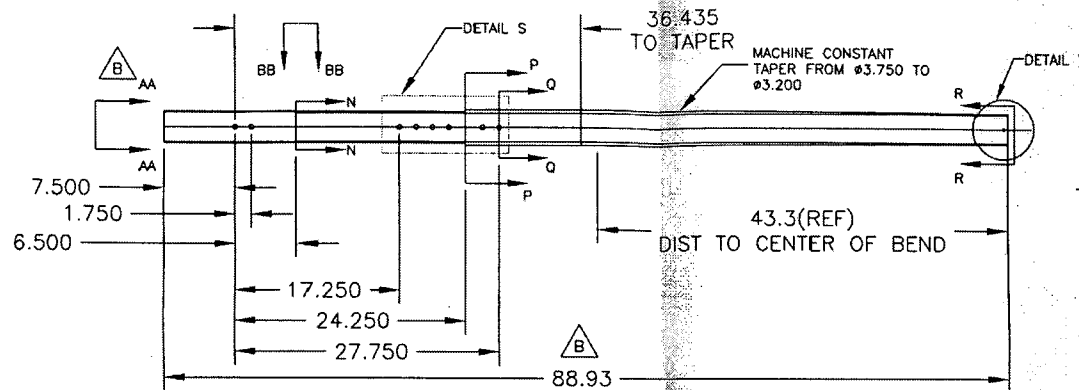

D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

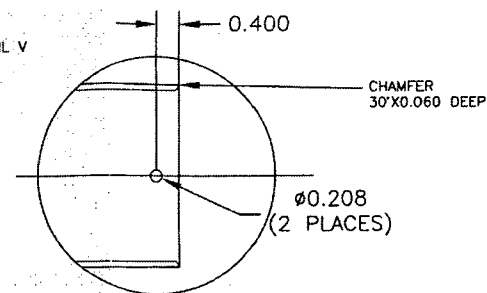


DETAIL V
(SCALE 1:2)


RELEASED

06-01-27


1.526^{+0.000}_{-0.030}

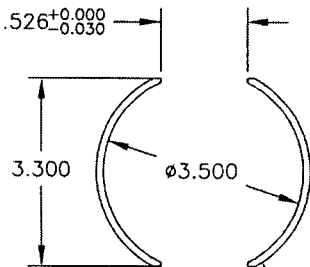


SECTION AA-AA
(SCALE 1:2)

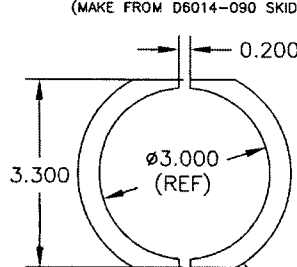


SECTION N-N
(SCALE 1:2)

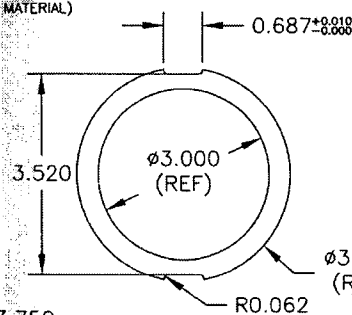


SECTION P-P
(SCALE 1:2)

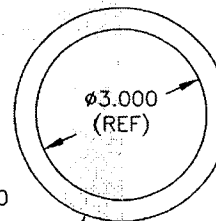


SECTION Q-Q
(SCALE 1:2)

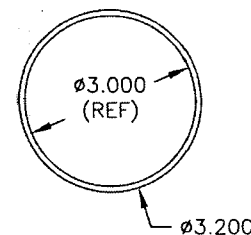

SECTION R-R
(SCALE 1:2)

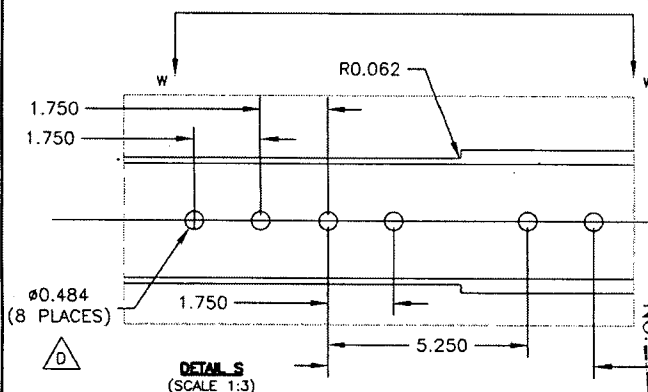

DETAIL S
(SCALE 1:3)

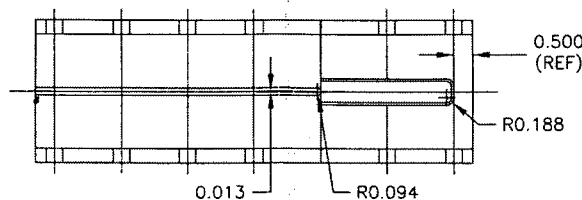

VIEW W-W
(SCALE 1:3)

NO. 26429
WORK ORDER
UNCONTROLLED COPY
ENGINEERING
RETURN TO
WITHOUT NOTICE
SUBJECT TO AMENDMENT



COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN	PH	DRAWN BY	PH
CHECKED	#	APPROVED	#
DATE	06.01.23		

DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	
DRAWING NO. D3391	REV. D SHEET 4 OF 5
TITLE 412 FLOAT SKIDTUBE	SCALE 1:12

RELEASED
06-01-27

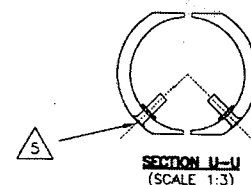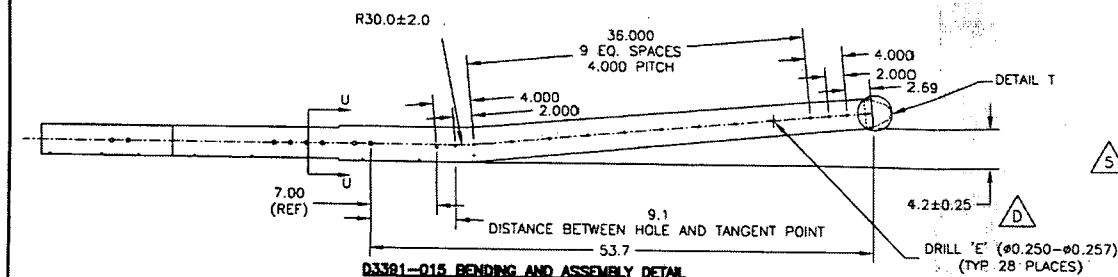


AN3C4A BOLT (1)
NAS1515H3L WASHER (1)
AN960C10L WASHER (1)
(2 PLACES)

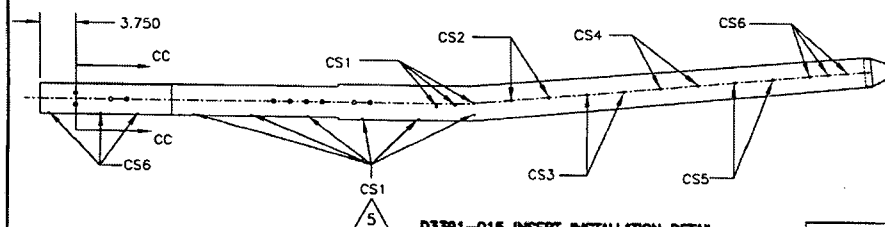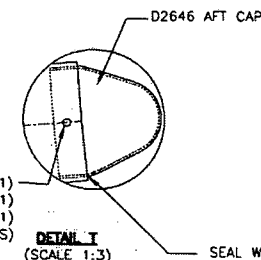


C/SINK AND INSTALL AESS10KBXXX AND/OR
NAS1330C3KBXXX IN HOLES MARKED CS1-CS6 AS
FOLLOWS

HOLES MARKED	QTY D3391-015	QTY D3391-025	C/SINK	P/N
CS1	18	14	Ø0.425	AESS10KB366
CS2	4		Ø0.391	AESS10KB366
CS3	4	2	Ø0.391	NAS1330C3KB316
CS4	4	2	Ø0.391	NAS1330C3KB266
CS5	4		Ø0.391	NAS1330C3KB216
CS6	12	8	Ø0.391	NAS1330C3KB166

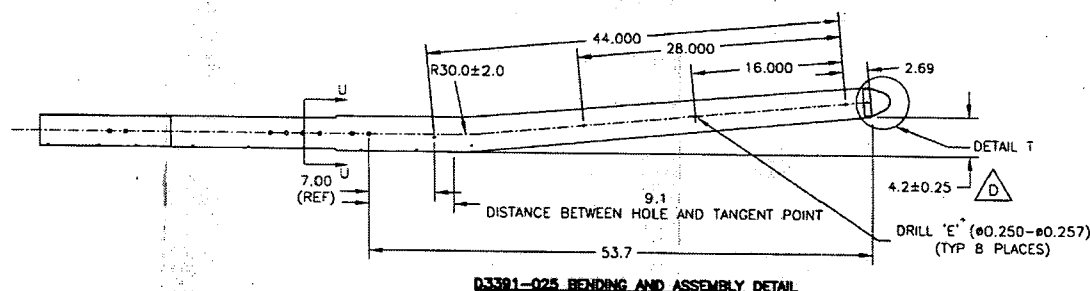


D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X		D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
18	14	AESS10KB366	INSERT
4	2	NAS1330C3KB316	INSERT
4	2	NAS1330C3KB266	INSERT
4		NAS1330C3KB216	INSERT
12	8	NAS1330C3KB166	INSERT
4		NAS1330C4KB151	INSERT
2	2	AN3C4A	BOLT
2	2	NAS1515H3L	WASHER
2	2	AN960C10L	WASHER

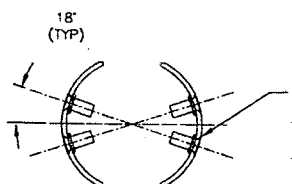

DRILL 'O' (#0.332-#0.338)
C/SINK (#0.529X100#)
NAS1330C4KB151 INSERT (1)
(4 PLACES)

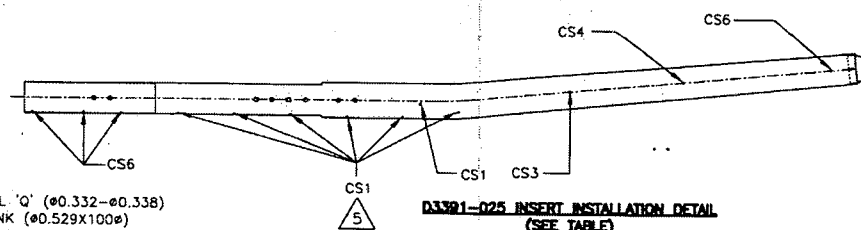

COPYRIGHT © 2000 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, OH
CHECKED #	APPROVED #	DRAWING NO. D3391
DATE 06.01.23	TITLE 412 FLOAT SKIDTUBE	REV. D SHEET 5 OF 5 SCALE 1:12

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NOR ORDER
06/01/29